

36



2006

36


Hard metal brazed tips, type 36. Design and dimensions

25414-90

25.100  
77.160  
19 6000

01.07.93

1.  
2.  
1.

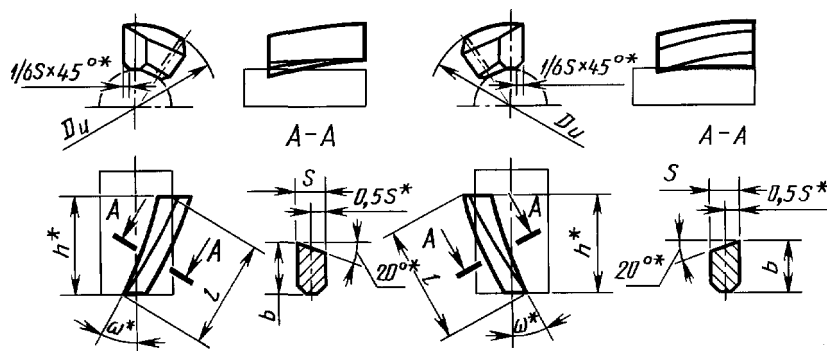

\*

		D	(0,	- t	s ±0,5	b ±0,5	l ±1,5	h		-
36350	—	16	30	87	2,0	4,0	15,0	13,0	4, 9	2, 10
36370	—						11,5	10,0	4, 9	2, 10
36390	—	20	30	109	3,0	6,0	24,0	21,0	4, 9	2, 10
36410	—						18,0	16,0	4, 9	2, 10
36010	—	32	40	120	3,5	8,0	25,0	19,0	4, 9	2, 10
36110	—						20,0	15,0	4, 9	2, 10
36030	36040	50	40	187	4,3	8,5	29,0	22,0	4, 9	2, 10
36130	36140						21,0	16,0	4, 9	2, 10

. 1

		$D$	(0,	$t$	$s$ $\pm 0,5$	$b$ $\pm 0,5$	$/$ $\pm 1,5$	$h$		$-$
36430	36440	80	30	435	5,0	10,0	30,0	26,0	4, 9	2, 10
36450	36460						23,0	20,0	4, 9	2, 10
36470	36480	100		544			31,0	27,0	4, 9	2, 10
36490	36500						23,0	20,0	4, 9	2, 10
36510	—	160		870			33,0	29,0	4, 9	2, 10
36530	—						25,0	22,0	4, 9	2, 10

« = it' »

- $t$  — ;  $\varepsilon$  — ( ) .
3. 0,3 , -
4. 0,7 .
- 0,6 . 0,3 ,
5. 0,7 ;
- 1,0 . — 25393.
- 6.
- 7.
8. — 2209.
9. ; 2 — 15 6; 4 — 5 10; 9 — 6; 10 — 8.

2

		15 6	5 10		8
36350	—	1,20	1,36	1,58	1,56
36370	—	0,92	1,05	1,22	1,21
36390	—	4,41	5,00	5,83	5,76
36410	—	3,36	3,81	4,45	4,39
36010	—	7,20	8,15	9,53	9,40
36110	—	5,67	6,44	7,50	7,40
36030	36040	10,70	12,10	14,10	13,90

. 3      25414-90

. 2

		15 6	5 10		8
36130	36140	7,76	8,80	10,30	10,10
36430	36440	15,00	17,00	19,90	19,60
36450	36460	11,60	13,10	15,30	15,10
36470	36480	15,10	17,10	19,90	19,70
36490	36500	11,20	12,70	14,80	14,60
36510	—	17,10	19,40	22,60	22,40
36530	—	13,00	14,70	17,20	17,00

1.

2.

31.10.90    2764

3.

25414-82

4.

-

2209-90	5
25393-90	3

5.